

### CHV50: Storm Drain Priority List

Year	Rank	SD_ID	Street	X-Street	Size	Length	Material	Comments
FY15	1	1638, 1640, 1693 1694, 9571, 9573, 10776	G ST	3rd Ave	48	480'	CMP, CMPA	3 connected pipe segments all CMP, Heavy corrosion and seperation throughout, flow restricted
FY15	2	10140	FOURTH AV	EMERSON ST	42	105'	CMPB	Pipe has holes in invert due to corrosion, pipe should be replaced, inspection includes 19519 & 19520
FY15	3	10141	FOURTH AV	EMERSON ST	30	165'	CMPB	Large corrosion throughout with a large hole due to corrosion, rehabilitation recommended
FY15	4	3517	NACION AV	THERESA WY	18	39'	CMP	Severe corrosion, large holes, replacement recommended
FY15	5	10251	J ST	BEECH AV	54	403'	CMP	Liner is missing at invert and pipe has corrosion throughout, repair or rehabilitation recommended
FY15	6	3777	PALOMAR ST	TOBIAS DR	36	570'	CMP	US access point is buried and hole in pipe invert blocked camera on US inspection
FY15	7	3773	TOBIAS DR	PALOMAR ST	36	418'	CMP	Moderate to large corrosion throughout and some small holes, rehabilitation recommended
FY15	8	5002	OLEANDER AV	MAIN ST	24	52'	CMP	Pipe is in poor condition with severe corrosion and moderate to large holes at flow line, rehabilitation recommended
FY15	9	10300	FOURTH AV	MOSS ST	30	317'	CMP	Large corrosion throughout, rehabilitation recommended
FY15	10	17781	THIRD AV	EMERSON ST	30	64'	CMP	Pipe is in poor condition with large corrosion and large holes, rehabilitation recommended